


| REVISIONS | | | |
|-----------|-----------------------------|----------|----------|
| REV | DESCRIPTION | DATE | APPROVED |
| 1 | Width tolerance was 8.0±0.3 | 01/07/00 | BTH |
| 2 | Add pocket hole | 11/08/05 | SFP |
| 3 | Drawing format changed | 11/08/05 | SFP |
| 4 | Remove pocket hole | 03/13/06 | SFP |

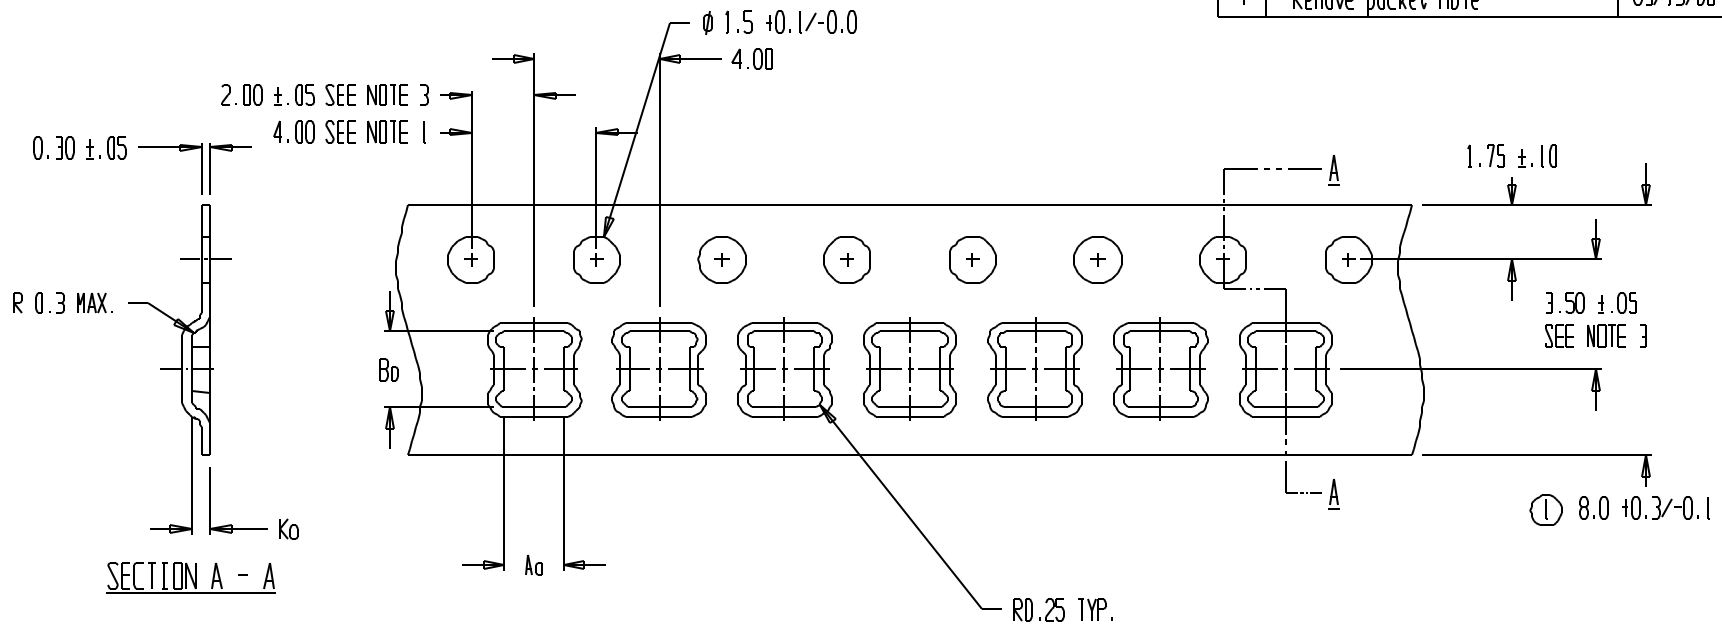

$A_o = 1.90$
 $B_o = 2.40$
 $K_o = 0.60$

NOTES:

1. 10 SPROCKET HOLE PITCH CUMULATIVE TOLERANCE ±0.2
2. CAMBER IN COMPLIANCE WITH EIA 481
3. POCKET POSITION RELATIVE TO SPROCKET HOLE MEASURED AS TRUE POSITION OF POCKET, NOT POCKET HOLE

| | | | |
|---|--------------------|--|--------------|
| ADVANTEK ③ | | | |
| TITLE ADVANTEK PART DRAWING NUMBER IR5191-A CARRIER TAPE | | | |
| TOLERANCES - UNLESS NOTED 1PL ±.2 2PL ±.10 | MATERIAL PS+C | ALL DIMENSIONS IN MILLIMETERS DWG SIZE B | |
| DRAWN BY BTH | DATE 08/21/1998 | SCALE 6:1 | SHEET 1 OF 1 |
| REFERENCE NO. T-7476-B | DWG NO. T-101674AT | REV 4 | |